

USH-8

Ultrasonic Snow Depth Sensor



Properties and Advantages

- » **Continuous and non-contact ultrasonic snow depth measurement**
- » **Reliable sensor for extreme conditions**
 - Correct measurement with snowfall and difficult reflection conditions
 - Automatic de-icing of the ultrasound membrane and sensor head
- » **High measuring accuracy**
 - Integrated temperature compensation
 - Intelligent measured signal conversion
- » **Energy-saving sensor operation**
 - “Standby” between the measuring phases
 - Optimum for solar-powered stations
- » **Simple sensor integration**
 - Analogue and digital interface
 - Parameterization via hyper terminal

Basis of Snow Depth Measurement

The measurement of snow depth is an important parameter for the measurement of the snow cover in the terrain. Its formation is subject to strong variance, based upon time and space factors. Influencing factors here are the development of snow cover, under the influence of further climatic events

(air temperature, wind, global radiation), the characteristics of the land, as well as the spatial distribution of precipitation in an area. Because of these factors, the selection of a suitable location for measurement is decisively responsible for whether this is representative for an area or not.

Principle and Accuracy of Measurement

The sensor's principle of measurement deals with the transit-time measurement of an ultrasonic pulse. The sensor transmits several energy-charged pulses to the snow cover and subsequently receives its reflected signals. Based upon the required transit time of the ultrasonic signals, the USH-8 sensor calculates the current snow depth. The processing time of the ultrasonic pulses here is enormously influenced by the air temperature. For this reason, the snow depth sensor also possesses integrated temperature compensation. This takes into account the influence of the air temperature on the processing time of the ultrasonic signals, in the calculation of the snow depth. The calculation takes place in the sensor, so that the output signal provides the already converted snow depth. In this manner, optimum measuring results are achieved, with an accuracy of 0.1 % (FS).

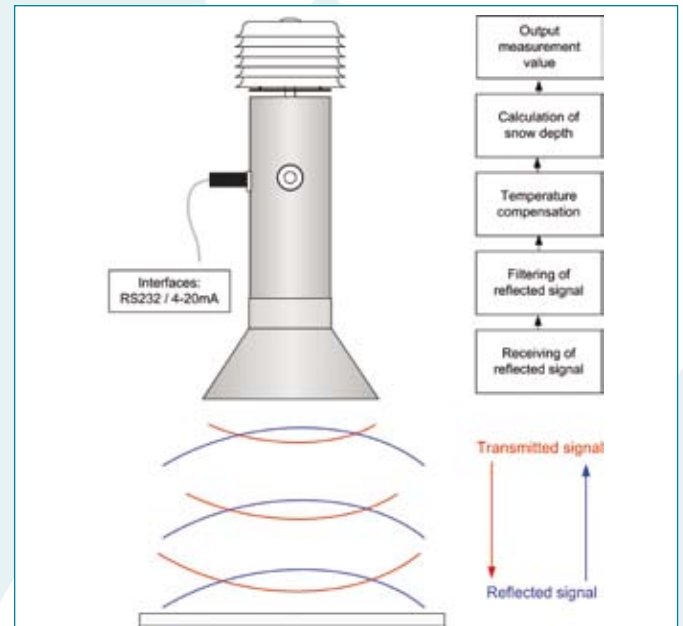


Fig. 1: Signal processing by the USH-8 snow depth sensor.

Reliable Sensor for Extreme Conditions

The USH-8 sensor is also highly reliable during extreme environmental conditions, thereby making possible a long-term reliability of in recording measured data.

This occurs with energy-charged 50 kHz ultrasonic pulses, and it also provides reliable results under the most difficult reflection conditions, as in the case of powder and new snow cover. By means of energy-charged ultrasonic pulses, the icing of

the ultrasonic membrane and sensor head is hindered, and an automatic de-icing is carried out. Moreover, an intelligent measured signal conversion is compensated, by means of filtration of snow and rain precipitation, occurring in the signal path of the ultrasonic signals during measurement. In this manner, correct measurement is also assured during precipitation, and there are no negative effects on the results of measurement.

Energy-Saving Sensor Operation

The USH-8 sensor automatically switches between measuring and “standby” operation. The data logger must not switch the sensor on and off, and in this manner a highly energy-saving operation is achieved. For the transfer of measured data, the USH-8 is activated by the data logger via “transfer pin”. For the measuring operation of the day, only

0.5 Ah is required per minute. Between the measuring phases, the sensor automatically switches to standby operation with <1 mA consumption. With this property of energy economy, the sensor is optimally suited for self-sufficient measuring stations using with solar power supplies.

Selection of the Measuring Location

The right selection and positioning of the measuring location is of very great importance. The field of measurement to be recorded should be most preferably flat, protected from wind and secured against avalanches. Steep hillsides, hollows, terrain edges or large rocks in the immediate vicinity of the measuring location should be avoided. Steeply sloping fields of snow harbour the danger that the snow cover could begin to slide, thereby


falsifying the measuring results. To ensure a problem-free measurement, the sensor must be aligned parallel to the ground. A minor incline of the ground can be compensated for by a correct alignment of the sensor, using the holding fixture provided. Furthermore, the expected snow depth at the location should be estimated, in order to assure a suitable mounting height for the sensor.

Assembly

The sensor has already been calibrated (temperature compensation) and preconfigured prior to delivery. In addition to the customer-specific settings (interface, protocol, ...), the zero point parameter for the location must be set after the installation. This is implemented easily and comfortably via the Windows Hyperterminal.

The optimal mounting height of the sensor is 3m or more. The maximum permissible mounting height is 10m. Care must be taken here that the diameter of the field of measurement in this case is greater than 3m. In order that the field of measurement is not disrupted, two distances must be kept in mind when setting up the station. Firstly, there is the distance between the sensor and the field of measurement, and secondly, there is the distance between the sensor and pole / pole base. When the field of measurement is disrupted, this can lead to undesired reflections, and therefore to incorrectly measured data. Objects in the vicinity of the field of measurement (i.e. terrain edges, buildings, ...) also create snow drifts, thereby causing undesired disruptions of the field of measurement.

The material of the field of measurement's surface must be representative of the area to be examined, since differing materials produce differing defrosting capacities, and may thereby lead to undesired disruptions of the field of measurement. For measurement in natural terrain, we recommend fine gravel or crushed rock for the preparation of the field of measurement's surface.

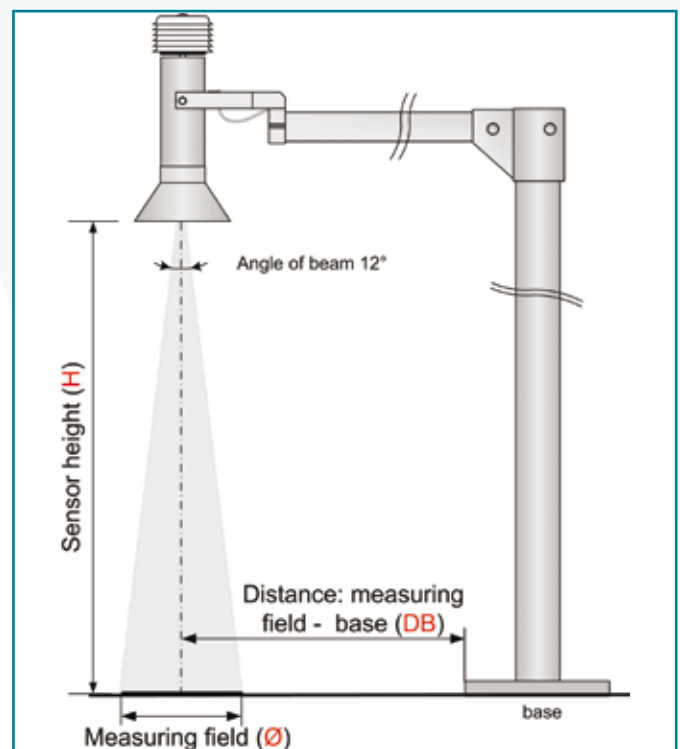

Sensor height H [m]	Measuring field Ø [m]	Minimum distance DB [m]
2	0,6	1,0
3	1,0	1,1
4	1,3	1,2
5	1,6	1,3
6	1,9	1,4
7	2,2	1,5
8	2,5	1,6
9	2,9	1,7

Fig. 2: Overview of the assembly dimensions of the USH-8 sensor.

Simple Integration into Existing Weather Stations

The measured value of the USH-8 snow depth sensor can be integrated into an already existing station, using either an analogue (0/4-20mA signal) or

a digital interface (RS 232). In addition, the provided pole-holding fixture allows for easy assembly.

Technical Specifications

Snow Depth Measurement	
Range of measurement	0 to 8 m
Minimum distance to the maximum expected snow depth	1 m
Accuracy	0,1 % (FS)
Resolution	1 mm
Principle of measurement	Ultrasonic (Frequency 50 kHz; Angle of reflected beam 12°)
Integrated Compensation of the Air Temperature	
Temperature sensor	Integrated air-temperature sensor in self-venting radiation shield
Range of measurement	-35 to 60 °C
Resolution	0,1 °C
Non-linearity	≤ 0,15 %
Interfaces	
Analogue	Snow depth measurement 0/4 - 20 mA signal (configurable) Resolution: 12 Bit Max. load: 300 Ω
Digital	Snow depth measurement; air temperature; quality flag RS 232; serial interface Protocol: Various ASCII formats
Other	
Power supply	Supply voltage: 10,5 to 15 VDC Current consumption: Measuring phase: max. 200 mA (approx. 3 sek) Stand by: <1 mA Power consumption: 0,5Ah / day (with measuring interval of 1 min)
Operating temperature	-35 to 60 °C
Housing	Dimensions: Ø 110 mm, length 350 mm Material: anodized aluminium Weight: 2 kg
Protective system	IP 66
Lightning protection	Integrated (discharge capacity 0.6 kA)
Sensor holding fixture	Clamp assembly for pole arm Ø 61 mm (2")
Accessories (not included in the price)	
Pole arm	Pole arm with tilting function for comfortable sensor assembly and maintenance: Holder for pole Ø 114mm, Hot-dip galvanized, Dimensions: Ø 61 mm (2"), length: 1600 mm

SOMMER GmbH & Co KG

Straßenhäuser 27

A-6842 Koblach

Tel.: +43 5523 55989 – 0

Fax: +43 5523 55989 – 19

Email: office@sommer.at

Internet: www.sommer.at

Copyright

© Copyright 2008 Sommer. V003. All rights reserved. Content may be changed without notice. Pictures, drawings and other graphic images are for illustration only and do not represent product configuration.

Exclusion

Subject to deliverability, technical changes and errors excepted.